



POLICE DEPARTMENT

LAKE HAVASU CITY

2360 McCULLOCH BOULEVARD NORTH
LAKE HAVASU CITY, ARIZONA 86403-5947

To Whom It May Concern:

I hereby attest that Michael T. Maloy, Jr. is a Certified Intoxilyzer Quality Assurance Specialist for the Lake Havasu City Police Department.

I certify that the attached documentation of Standard Quality Assurance Procedures and/or Standard Calibration Check Procedure are full, true and correct copy of the original.


Michael Maloy Jr #281
Signature

STATE OF ARIZONA)
) ss
COUNTY OF MOHAVE)

Subscribed and sworn to before me this 30th day of OCTOBER
2025 by MICHAEL MALOY

Jennifer Lentz
NOTARY PUBLIC

10/30/2025
DATE

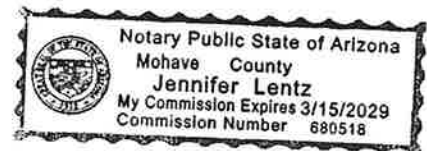

Commission expires: 03/15/2029

Area Code 928

Administration 855-4884
Business Office 855-1171
Investigations 855-5775
Patrol 855-0515

Fax #'s
Administration 680-5430
Business Office 680-5431
Investigations/Patrol 680-5432

Emergency 9-1-1
Non-Emergency Dispatch/ 855-4111
Havasut Silent Witness 854-TIPS

E-mail: police@lhcaz.gov

EXHIBIT I-2

THIS REPORT PREPARED PURSUANT TO DUTY IMPOSED BY A.A.C. R13-10-104 (A)

ARIZONA DEPARTMENT OF PUBLIC SAFETY
INTOXILYZER MODEL 9000

PERIODIC MAINTENANCE AND STANDARD QUALITY ASSURANCE PROCEDURE

QA SPECIALIST M. MALOY #281 AGENCY LHCPD
DATE 10-30-2025 TIME 00:08
INTOXILYZER SERIAL # 90-003695

- ☒ 1. Ensure that gas tank is attached and contains a standard alcohol concentration 0.100 AC

DIAGNOSTIC TESTS

- ☒ 1. Clock time check
☒ 2. Date check

OPERATIONAL TESTS

- ☒ 1. Deficient Subject Test (Proper Sample Recognition)
Deficient Sample printed
- ☒ 2. Alcohol-free Subject Test (Proper Sample Recognition):
0. 000 AC
- ☒ 3. Mouth Alcohol Subject Test (Proper Sample Recognition):
Invalid Sample – Begin new deprivation period printed
- ☒ 4. Radio Frequency Interference Test (Error Recognition):
RFI Detect printed
- ☒ 5. Standard Calibration Check:
0. 099 AC
- ☒ 6. Air Blanks Completed
- ☒ 7. Timer Reset

Not a Successfully Completed Test Sequence will be printed

Instrument is operating properly and accurately. YES ☒ NO ☐

COMMENTS:

- PLACED INTO SERVICE IN JAIL
- STANDARD CHANGE

P.S.I.: 425

SIGNATURE

Michael Maloy Jr #281

ARIZONA FORENSIC BREATH ALCOHOL ANALYTICAL REPORT

INSTRUMENT INFORMATION

Analytical Instrument: Intoxilyzer 9000
Serial Number: 90-003695
Software Version: 9439.01.00
Analytical Report Number: 36951030250361

QAS: MALOY, MICHAEL
QAS Permit #: 30178
Agency: LAKE HAVASU PD
Last 31-Day Check: 09/02/2025
Last Annual Maintenance: 10/08/2025

SUBJECT INFORMATION

Name: 31-Day Check
Test Date: 10/30/2025
Driver's License #:
Gender:
Date of Birth:
Age:

Weight:
State of Issue:
Driver's License Expiration:
Deprivation Start Time: 23:45
15 - Minute Deprivation: Yes

OPERATOR INFORMATION

Name: MALOY, MICHAEL
Agency: LAKE HAVASU PD

Permit #: 30178

STANDARD INFORMATION

Standard Value: 0.100
Standard Lot #: 302-403183349
Expiration Date: 01/24/2027
Bottle #: 048
Last Changed By: MALOY, MICHAEL

Permit #: 30178

Test	g/210L	Time
Air Blank	0.000	00:08:18
Diagnostic Test	PASS	00:08:53
Air Blank	0.000	00:09:30
Calibration Chk	0.099	00:09:51
Air Blank	0.000	00:10:31
Subject Test 1	DEF*	00:13:46
Air Blank	0.000	00:14:35
Air Blank	0.000	00:15:15
Subject Test 2	0.000	00:15:53
Air Blank	0.000	00:16:38
Wait		00:20:42
Air Blank	0.000	00:21:19
Subject Test 3	INV**	00:22:06
Air Blank	RFI***	00:22:20

RESULTS

EXCEPTION MESSAGES

*Deficient Sample
**Invalid Sample - Begin new deprivation period
***RFI Detect

* Deficient Sample
** Invalid Sample - Begin new deprivation period
*** RFI Detect

OPERATOR COMMENTS

All air blank results must be 0.000.
Consecutive subject test results must not differ by more than 0.020 g/210L.
Standard check results must be $\pm 10\%$.

Not a Successfully Completed Test Sequence

STANDARD CHANGE

281

Intoxilyzer - Alcohol Analyzer

Model 9000

SN: 90-003695

Test Date: 10/30/2025

Test Time: 00:05

Location:

Software Version: 9439.01.00

Standard Lot #: 302-403183349

Standard Value: 0.100

Expiration Date: 01/24/2027

Bottle #: 048

Last Changed By: MALOY, MICHAEL

Permit #: 30178

Operator: MALOY, MICHAEL

Permit #: 30178

Agency: LAKE HAVASU PD

Test	g/210L	Time
Air Blank	0.000	00:06:19
Calibration Chk	0.098	00:06:41
Air Blank	0.000	00:07:21

No RFI Detected

Successfully Completed Test Sequence